

# Building Report

---

## **Disclaimer**

This document has been obtained on behalf of the Vendor and copies have been made available to prospective Purchasers and interested parties for general information purposes only. However, neither the Vendor nor Bayleys in the North (Mackys Real Estate Limited), warrant the accuracy of this copy and they accept no liability for any errors or omissions in the report. It is recommended to all prospective Purchasers and interested parties that they obtain and rely on their own reports and make their own independent enquiries for due diligence purposes.



## **Property Condition Report**

---

**66a King Street  
Kensington  
Whangarei District**

**Client:** Paul Sumich C/- Bayleys Whangarei

**Inspection Date:** 9/03/2022

# REPORT CONTENTS

REPORT INTRODUCTION	3
EXECUTIVE SUMMARY	4
PROPERTY DESCRIPTION	5
CLIENT & INSPECTION DETAILS	6
SITE FEATURES	7
NORTH ELEVATION	8
EAST ELEVATION	10
SOUTH ELEVATION	11
WEST ELEVATION	12
FOUNDATION	13
ROOF	14
ROOF SPACE	17
KITCHEN	19
LOUNGE	21
BEDROOM 1	22
BEDROOM 2	23
BEDROOM 3	24
BATHROOM 1	25
LAUNDRY	27
INTERNAL GARAGE	28
DWELLING SERVICES	30
INSPECTION SCOPE & STATEMENT OF POLICY	33

## REPORT INTRODUCTION

Dear Paul Sumich C/- Bayleys Whangarei.

RE: Property Inspection Report: 66a King Street, Kensington.

Thank you for the opportunity to provide you with the following report, we hope it aids you with your investment.

This report has been compiled following a site inspection carried out on the 9/03/2022.

Please read this report in its entirety.

This report should not be seen as an all-encompassing report dealing with a building from every aspect, but rather a reasonable attempt to identify any significant defects visible at the time of the inspection.

This report is not a warranty against problems developing with the building after the date of the report. It is outside the scope of this report to investigate, or comment on if the dwelling complies with any building code legislations or local body bylaws.

Scope Building Surveyors recommend that quotes and advice are sought from Independent Qualified Persons on receipt of the property report for a more specific qualification of comments made by Scope Building Surveyors in the report, regarding any faults or defects identified, if more intrusive investigation is desired or simply in relation to any comment made.

This also applies to any verbal communication made by Scope Building Surveyors regarding any faults or defects identified or comments made.

If you require any clarification or wish to discuss any details of the report, please do not hesitate to contact us.

Yours sincerely

***Scope Building Surveyors Ltd***

## EXECUTIVE SUMMARY

Overall based on a visual examination, the property exterior as inspected is considered to be in an average condition for the age of the property and the materials and finishes incorporated.

The interior of the House is again in an average condition considering the age of the fittings and finishes.

The following items have been flagged during the inspection and need to be taken in to consideration.

## REPAIR OR REPLACEMENT RECOMMENDED

### ROOF

#### FASCIA

##### *Findings:*

Evidence of decay to timber fascia board above kitchen. Decayed fascia may increase the risk of moisture ingress to roof space. We recommend engaging the services of a Builder to replace damaged Fascia as required.

## MAINTENANCE RECOMMENDED

### ROOF

#### ROOF COVERING

##### *Findings:*

Contaminant build up to roof covering. We recommend cleaning roof covering annually or as required during periodic maintenance to ensure the finished coating is not compromised by growth and airborne contaminants.

## SUMMARY CONCLUSION

Findings noted during the inspection should be taken into consideration and receive eventual attention, as some of these if left unattended may have the potential to affect the durability of materials or habitability of the house.

We recommend further investigation for any item that may impede habitability; is considered unsafe or hazardous; does not operate properly or perform its intended function in response to normal use.

Items identified as requiring repair or replacement either are or have potential to significantly affect habitability and/or can be considered as requiring reasonable expense to mitigate and should be evaluated by professionals in appropriate trades prior to closing.

Minor defects are common to most properties and may include minor blemishes, corrosion, cracking, weathering, general deterioration, unevenness, and physical damage to materials and finishes that could be expected with age, and general wear and tear.

## PROPERTY DESCRIPTION

Facing the roadside to the West, this single storey building is situated on a sloping section, above road level.

Consisting of three bedrooms, one bathroom and an internally accessed single bay garage with access from the street provided by a paved concrete driveway.

Foundations comprise of a reinforced concrete slab.

Exterior cladding consists of painted fibre cement weatherboard, direct fixed and brick veneer with single glazed aluminium joinery.

A hip framed roof has been constructed with a pre fabricated timber truss and clad in pressed metal roof tiles.

The building appears to have been originally constructed in 2009 with no signs of alterations over the intervening years.

## CLIENT & INSPECTION DETAILS

### JOB BOOKING

Reference Number	2022/1434.
Property Address	66a King Street.
Inspection Type	Property Condition Report.
Date of Inspection	9/03/2022.
Time of Inspection	12:00 am.
Property Type	Residential.
Present at Inspection	Vendors Agent.
Occupancy	Vacant.

### CLIENT DETAILS

Report Commissioned by	Paul Sumich C/- Bayleys Whangarei.
Email Address	paul.sumich@bayleys.co.nz.

### WEATHER CONDITIONS

Atmosphere	Fine.
Soil	Soil conditions were dry at the time of the Inspection.

### BUILDING CHARACTERISTICS

Building Orientation	Facing the roadside to the West.
Site Contour	Sloping section, above road level.
Approx Year of Construction	2009.
Building Type	Stand alone.
Levels	Single storey.

### UTILITY'S

Water Source	Mains Supply.
Sewage Disposal	Council Sewage System.
Power Supply	Underground Power Supply.

# SITE FEATURES

## DRIVEWAY

Description

Concrete Surface.



## SURFACE WATER CONTROL

Description

Surface water is caught via drain/sump and fed to the street.





# NORTH ELEVATION

## OVERVIEW

North Section:



## CLADDING SYSTEM

Description:

Painted fibre cement weatherboard, direct fixed.



Drained and vented masonry veneer.



## EXTERIOR JOINERY

Description:

Aluminium joinery,  
single glazed.



# EAST ELEVATION

## OVERVIEW

East Section:



## CLADDING SYSTEM

Description:

Painted fibre cement weatherboard, direct fixed.



## EXTERIOR JOINERY

Description:

Aluminium joinery, single glazed.



# SOUTH ELEVATION

## OVERVIEW

South Section:



## CLADDING SYSTEM

Description:

Painted fibre cement weatherboard, direct fixed.



## EXTERIOR JOINERY

Description:

Aluminium joinery, single glazed.



# WEST ELEVATION

## OVERVIEW

West Section:



## CLADDING SYSTEM

Description:

Drained and vented masonry veneer.



## EXTERIOR JOINERY

Description:

Aluminium joinery, single glazed.



# FOUNDATION

## CONSTRUCTION TYPE

Description: Concrete slab foundation.

# ROOF

## ROOF COVERING

Accessibility:

Roof covering inspected from the access of a 3.6m ladder only. Inspection of areas not visible from the access of a 3.6m ladder may require additional access such as scaffolding or a fall arrest system.

Description:

Pressed metal roof tiles.



### Findings:

Contaminant build up to roof covering. We recommend cleaning roof covering annually or as required during periodic maintenance to ensure the finished coating is not compromised by growth and airborne contaminants.



## GUTTERS

Description:

Pressed colorsteel gutter system.



## FASCIA

Description:

Painted timber fascia boards.



### Findings:

Evidence of decay to timber fascia board above kitchen. Decayed fascia may increase the risk of moisture ingress to roof space. We recommend engaging the services of a Builder to replace damaged Fascia as required.



## SOFFITS

Description:

Painted Fibrecement board with PVC jointers.



Approximate Width:

600mm.



## DOWNPIPES

Description:

PVC downpipes  
discharging to Council  
Storm water system.



# ROOF SPACE

## ACCESS

Location

Roof space access via manhole located in the Hallway.



## ROOF CONSTRUCTION

Description:


Timber Truss framed roof.



## ROOF COVERING UNDERLAY

Description:

Self supported Bituminous paper underlay.

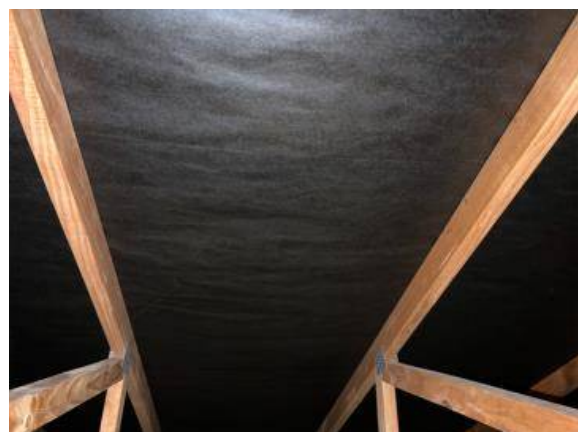

## INSULATION

Description:

Bulk insulation segments between ceiling joists.



Approximate Thickness:

180mm.

## ELECTRICAL WIRING

Description:

Visible roof space Electrical wiring consists of TPS.

# KITCHEN

## LOCATION

Description: Open plan with Lounge.



## FLOOR COVERING

Description: Vinyl floor covering.

## WALL LINING

Description: Wallpaper over Plasterboard.

## CEILING

Description: Painted Plasterboard.

## KITCHEN JOINERY

Description: Meltica Carcass.

## BENCH TOP

Description: Laminate Formica.

## SINK

Description: Stainless steel sink, Mixer style tap, PVC waste.

## SPLASH BACK

Description: Tiled splashback.

## OVEN

Description: Recessed electric wall oven.

## HOB

Description: Electric bench hob, analogue control.

## **RANGE HOOD**

Description: Wall hung unit vented through soffit.

## **DISHWASHER**

Description: Freestanding dishwasher.

## **ELECTRICAL PROVISIONS**

Description: Sockets tested and working at the time of inspection.

# LOUNGE

## LOCATION

Description:

Open plan with Kitchen.



## FLOOR COVERING

Description:

Carpet floor covering.

## WALL LINING

Description:

Wallpaper over Plasterboard.

## CEILING

Description:

Painted Plasterboard.

## ELECTRICAL PROVISIONS

Description:

All sockets tested and working at the time of inspection.

# BEDROOM 1

## LOCATION

Description: Master bedroom.



## FLOOR COVERING

Description: Carpet floor covering.

## WALL LINING

Description: Wallpaper over Plasterboard.

## CEILING

Description: Painted Plasterboard.

## INTERIOR JOINERY

Description: Painted hollow core with timber frame.

## STORAGE

Description: Built in double wardrobe.

## ELECTRICAL PROVISIONS

Description: All sockets tested and working at the time of inspection.

## BEDROOM 2

### LOCATION

Description: Second left off hallway.



### FLOOR COVERING

Description: Carpet floor covering.

### WALL LINING

Description: Wallpaper over Plasterboard.

### CEILING

Description: Painted Plasterboard.

### INTERIOR JOINERY

Description: Painted hollow core with timber frame.

### STORAGE

Description: Built in double wardrobe.

### ELECTRICAL PROVISIONS

Description: All sockets tested and working at the time of inspection.



## BEDROOM 3

### LOCATION

Description:

First right off hallway.



### FLOOR COVERING

Description:

Carpet floor covering.

### WALL LINING

Description:

Wallpaper over Plasterboard.

### CEILING

Description:

Painted Plasterboard.

### INTERIOR JOINERY

Description:

Painted hollow core with timber frame.

### STORAGE

Description:

Built in single wardrobe.

### ELECTRICAL PROVISIONS

Description:

All sockets tested and working at the time of inspection.

# BATHROOM 1

## LOCATION

Description: Off hallway.



## FLOOR COVERING

Description: Vinyl floor covering.

## WALL LINING

Description: Painted Plasterboard.

## CEILING

Description: Painted Plasterboard.

## INTERIOR JOINERY

Description: Painted hollow core with timber frame.

## VANITY

Description: Freestanding melteca carcass with composite top.

## **SHOWER**

Description:

Modular shower unit with moulded wall liner, glass door and composite base.

Water Pressure:

Average water pressure at the time of inspection.

## **BATH**

Description:

Built in composite bath, Tiled surround.

## **TOILET**

Description:

S-Trap, Ceramic bowl, dual flush ceramic cistern.

## **VENTILATION**

Description:

Passive ventilation via window. Mechanical ventilation via extraction unit.

## **ELECTRICAL PROVISIONS**

Description:

All sockets tested and working at the time of inspection.

# LAUNDRY

## LOCATION

Description: In Garage.



## FREESTANDING TUB

Description: Freestanding tub with coated steel base, stainless sink. Supplies water provisions and waste for Washing Machine.



## VENTILATION

Description: Passive ventilation via window.

## ELECTRICAL PROVISIONS

Description: All sockets tested and working at the time of inspection.

# INTERNAL GARAGE

## LOCATION

Description: Off Hallway.



## FLOOR COVERING

Description: Polished Concrete floor.

## WALL LINING

Description: Painted Plasterboard.

## CEILING


Description: Painted Plasterboard.

## INTERIOR JOINERY

Description: Painted hollow core with timber frame.

## GARAGE DOOR

Description: Single sectional, metal clad. Automatic operation.

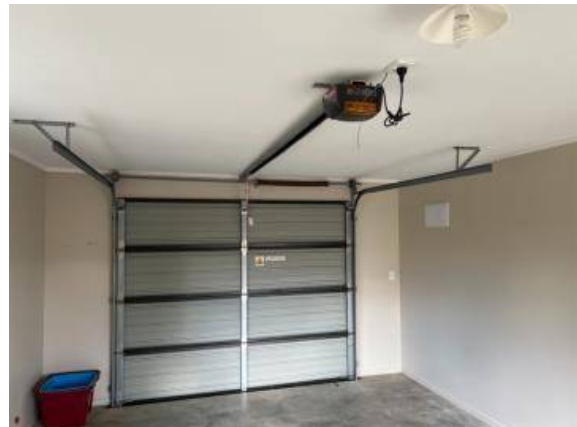

## ELECTRICAL PROVISIONS

Description:

Sockets tested and working fine at the time of inspection.

# DWELLING SERVICES

## FIRE WARNING & CONTROL SYSTEMS

Description: Individual Smoke detection devices. Not tested as part of this inspection. Periodic inspection is advise to ensure all devices are in working order.



## HEATING SYSTEMS

Description: Heat pump. This unit was not assessed as it falls outside the scope of this inspection, further inspection from a heating specialist is recommended.



## ELECTRICITY SERVICES

Description: RCD switchboard located in garage.



## WATER SERVICES

Description:  
Catchment:

Water supply to site via council mains, Water supply via on site collection.  
Reticulation system,  
plastic tank.



## HOT WATER SERVICES

Description:

Hot water cylinder.  
Cylinder is restrained.



Size:  
Year of manufacture:

Approximately 135ltr.  
Unable to confirm.



## FOUL WATER DISPOSAL

Description:

Foul water discharged to council supply.

## INSPECTION SCOPE

This inspection is based on experience and reasonable opinion and is not a guarantee against moisture ingress at the time of inspection or in the future. This inspection has been carried out to the writer's best ability with all reasonable care taken using visual and non-invasive testing with meters as noted. This report is a guide only (as per NZS 4306:2005) and not a guarantee against moisture ingress or structural failure and is to be accepted as such by the owner.

All reasonable attempts have been made to identify any significant defects visible at the time of the inspection. The inspector has not moved furniture, fixtures, stored items, soils, plants, checked window/door locks, etc. at the time of inspection. He cannot see inside walls or other concealed areas and cannot detect damage or defects that are not visible in most cases. The aid of testing equipment was used at the time of inspection, but these tools have limitations and cannot detect defects in all circumstances.

Whether or not services have been used for some time prior to an inspection being carried out may affect the detection of leaks and other defects. For example, in the case of a shower enclosure, the absence of any dampness at the time of inspection does not necessarily mean that the enclosure will not leak.

A Trotec T660 non-invasive moisture meter was used as an aid in this inspection. This in itself cannot be used to confirm or eliminate the possibility of moisture or deterioration in the framing timber or underlying materials. It is of limited use with some plaster systems and other factors. If elevated moisture readings are identified during the inspection, these will be recorded in the report.

This property report is not a Code of Compliance Certificate or a Certificate of Acceptance under the Building Act. It is also not a statement that the property complies with the requirements of any other Act, regulation or by-law. Nor is this property report a warranty against problems developing with the building after the date of this report. This inspection should not be confused with an appraisal, building code inspection or any guarantee of any kind, but as a tool to aid you to be better prepared and knowledgeable.

Inspections – over three meters. Worksafe regulations state that working at heights over three meters is done safely. If climbing over three meters then Worksafe state – guarding, safety nets or fall arrest systems should be in place. This is impracticable in the situation of house inspections, therefore our policy is, that Inspector's only climb as far as their ladders take them, keeping their own personal safety paramount.

Reasonable access – areas where safe, unobstructed access is provided and the minimum clearance's specified below are available; or where these clearance's are not available, areas within the inspector's unobstructed line of sight:

Roof space – access manhole 450 x 400mm; crawl space 600x 600mm; height accessible from a 3.6m ladder or such other means of access that meet H&S requirements.

Subfloor – access manhole 500 x 400mm; crawl space vertical clearance timber floor 400mm (from underside of bearer) Concrete floor 500mm.

Roof exterior – accessible from a 3.6m ladder or such other means of access that meet Worksafe requirements.

This inspection has been undertaken in accordance with the guidelines as set down by Standards New Zealand NZS4306:2005.

## STATEMENT OF POLICY

- a) This is a report of a visual only, non-invasive inspection of the areas of the building which were readily visible at the time of inspection. The inspection did not include any areas or components which were concealed or closed in behind finished surfaces (such as plumbing, drainage, heating, framing, ventilation, insulation or wiring) or which required the moving of anything which impeded access or limited visibility (such as floor coverings, furniture, appliances, personal (property, vehicles, vegetation, debris or soil).
- b) The inspection did not assess compliance with the NZ Building Code including the Code's weather tightness requirements, or structural aspects. On request, specialist inspections can be arranged of weather tightness or structure or of any systems including electrical, plumbing, gas or heating.
- c) The purpose of the inspection was to assess the general condition of the building based on the limited visual inspection described in this report and may not identify all past, present or future defects. Descriptions in this report of systems or appliances relate to existence only and not adequacy or life expectancy. Any area or component of the building or any item or system not specifically identified in this report as having been inspected was excluded from the scope of the inspection.
- d) This report has been prepared on the basis of a visual inspection of the building works using normal readily available access, and without testing of components for the assessment of the overall structural condition of it and associated items, and without recourse to construction drawings.
- e) This report is based on experience and reasonable opinion however is not a guarantee against moisture ingress at the time of inspection or in the future. This inspection has been carried out to the writer's best ability with all reasonable care taken using visual and non-invasive testing with meters as noted. This report is a guide only (as per NZ Standard 4306:2005) and not a guarantee against moisture ingress or structural failure and is to be accepted as such by the owner.
- f) It is confirmed that no detailed geotechnical investigation has been included in this brief. An investigation of the condition and location of underground drainage and services and of electrical, gas and plumbing (except as otherwise may be described in this report) is not included in this brief.
- g) No warranty can be given as to other defects, not apparent to visual inspection at the time; inclusive of underground services, waterproofing, soil stability or the moisture content in partitions or exterior cladding's.
- h) Weather conditions can affect moisture found e.g. long dry spells, driving rain in certain directions which can cause localised leaks and may only occur three to four times per year. Guidelines as below, flashings, ground levels, etc. This stresses the importance of flashings, ground levels, etc., which may be highlighted in this report.
- i) This property report does not include the structural, electrical, plumbing or gas piping and fitting, home heating state of the premises, as our consultants are not qualified for this but can arrange for these areas to be inspected by those people whose qualifications enable them to do so.
- j) This report does not include any positioning of building or improvements in relation to site boundaries, or provide any guarantee whatsoever those items surveyed will not fail at some later date, and information herein pertains strictly to observations the day of inspection and accessibility only.
- k) If the property is controlled by a Body Corporate or similar it would be recommended prior to purchase a copy of the minutes be obtained from the Corporate Secretary to establish the history of the inspected property or other properties under such Body Corporate. This inspection has been undertaken on this sole dwelling and does not extend to remainder of complex, or common areas. The inspection is confined to the above property only and does not cover structural integrity of the entire complex.
- l) This document and information contained within is intended only for the use of the addressee named above.

All reasonable measures have been employed to detect possible defects but give no warranty against, and is not limited to:

- m) the assessment of an apparent defect which may be subject to extreme weather conditions
- n) misinformation supplied by vendor, agent, person for whom report being prepared.
- o) concealment, intentional or otherwise, of a possible defect.

- p) assessment of any apparent defect which may occur intermittently or usually occurs after regular use.
- q) presence of chattels, furnishings and personal effects
- r) adequacy of footings
- s) adequacy of concealed damp-proof membrane's
- t) adequacy of concealed drainage
- u) swimming pools, spa pools, sauna's and associated equipment
- v) the operation of fireplaces and chimneys
- w) intercom systems
- x) floor coverings
- y) appliances, including but not limited to; dishwasher's, waste disposal units, ovens, ducted vacuum systems
- z) structural stability (other than pipe instability)
- aa) hazards including but not limited to Asbestos and Illicit Substance contamination.
- ab) hot water cylinders
- ac) window/door locks, bolts, etc.
- ad) any other factors limiting the preparation of this report.

CONFIDENTIAL REPORT: This report is **prepared solely and exclusively** for the clients own information and may not be relied upon by any other person. The client agrees to maintain the confidentiality of the inspection report and agrees not to disclose any part of it to any other person. The client may distribute copies of the inspection report to the seller and the real estate agents directly involved in this transaction, but said persons are not specifically intended beneficiaries of this agreement or the inspection report. The client and the inspector do not in any way intend to benefit said seller or the real estate agents directly or indirectly through this agreement or the inspection report. The client agrees to indemnify, defend and hold the inspector harmless from any third party claims arising out of the clients unauthorised distribution of the inspection report.