

Building Report

Disclaimer

This document has been obtained on behalf of the Vendor and copies have been made available to prospective Purchasers and interested parties for general information purposes only. However, neither the Vendor nor Bayleys in the North (Mackys Real Estate Limited), warrant the accuracy of this copy and they accept no liability for any errors or omissions in the report. It is recommended to all prospective Purchasers and interested parties that they obtain and rely on their own reports and make their own independent enquiries for due diligence purposes.



WHANGAREI BUILDING
INSPECTIONS

Building Inspection Report



Client: Paul Sumich - C/o Bayleys
Location: 1 Kentia Lane, Whau Valley
Whangarei
Inspection Date: 01/02/2022



027 7627826

buildmanage.wbi@gmail.com

www.whangareibuildinginspections.com

PO Box 4066, Kamo 0141



Dear Paul Sumich - C/o Bayleys,

RE: Building Inspection Report, 1 Kentia Lane, Whau Valley, Whangarei.

Thank you for the opportunity to inspect this dwelling.

Please find following my completed non-invasive, visual, above the ground report which I encourage you to read in its entirety.

The purpose of the report is to identify areas of interest/concern, NOT to provide independent expert advice on specific elements and NOT to recommend solutions to faults identified. The purpose of the inspection is to provide an impartial, technically knowledgeable and visually thorough account of the properties general state being the next best step toward assisting a purchaser in determining the appropriateness of the purchase to their individual threshold for maintenance and repair.

Recent events in the building industry relating to weathertightness and durability have highlighted some failures in the construction, design and material selection and the necessity for on-going maintenance of all buildings. Ongoing maintenance on the structure, roof, plumbing, electrical and gas systems is often neglected and yet they pose high risk factors to the overall integrity of buildings.

The sale and/or purchase of residential property is an important decision and should be contemplated only with the knowledge of the circumstances surrounding the property.

If you require any clarification or wish to discuss any details of the report with me, please do not hesitate to contact me on 027 7627826.

By accepting this report, it will be taken you have read the report in its entirety including this cover letter and the terms & conditions, and that you understand and accept these conditions.

Kind Regards

Mike Wooding

Mike Wooding
Property Inspector
027 7627826
buildmanage.wbi@gmail.com



027 7627826



buildmanage.wbi@gmail.com



www.whangareibuildinginspections.com



PO Box 4066, Kamo 0141



Table of Contents

1. Summary and inspection detail
2. Property Description
3. The Property Inspection Report
 - a. Purpose of the property inspection
 - b. The property reports
4. Equipment Used
5. Utility's
6. Smoke detector
7. Moisture Reading Report
8. Referenced Documents
 - 2.1 New Zealand Standards
 - 2.2 New Zealand Legislation
 - 2.3 Other Documents
9. Exclusions
10. Limitations
11. Definitions
12. Interpretation
13. Abbreviations
14. Property Inspection photos
15. Certificate of Inspection
16. Terms and conditions



027 7627826



buildmanage.wbi@gmail.com



www.whangareibuildinginspections.com



PO Box 4066, Kamo 0141



1. Summary & Inspection detail

DESCRIPTION	DETAILS
Prepared for:	Paul Sumich-Bayley
Inspected by:	Mike Wooding
Inspection date:	01/02/2022
Inspection address:	1 Kentia Lane, Whau Valley Whangarei
Year of Construction:	Est.1995
Property Occupied:	Yes
Weather conditions:	Overcast 2:00pm
Property Type:	Single Level House
Building Type:	Residential
Levels:	Single
EXTERIOR	
Security Alarm/camera:	Sensors are present in hallway and dining but no keypad could be found
Exterior Cladding:	Weatherboard, Fibrolite and Brick
Foundations:	Timber
Underfloor Insulation:	Yes
Construction Type:	Timber framed
Window joinery/frame:	Aluminium and single glazed
Roof Design & Material:	Hip, valley, and coloured tile
Downpipes:	PVC
Fascia's:	Colour steel
Soffit's:	Fibrolite
Spouting:	Internal gutter to fascia



027 7627826



buildmanage.wbi@gmail.com



www.whangareibuildinginspections.com



PO Box 4066, Kamo 0141



Direction that dwelling faces:	Kitchen – Northeast Dining – North
Retaining walls:	Small timber and rock walls
Driveway:	Concrete
Paths/steps:	Metal, Paving and concrete
Section gradient	Sloping
Surface water control:	Natural and controlled to garage
Fencing:	Semi fenced with timber framing, rock, plywood, and palings.
INTERIOR	
Interior Lining:	Gib and Paint
Floor coverings:	Vinyl, Carpet and Tiles
Heating:	Heat pump
Ventilation system:	HRV vent
Heat transfer system:	N/A
Kitchen Bench top:	Laminate
Kitchen Cabinetry:	Veneer carcass
Kitchen extraction system:	Yes
Shower type:	Acrylic
Vanity Type:	Acrylic
Bath	Acrylic
Bathroom extraction system:	Yes, for both bathrooms
Smoke Detector	Present in Hallway and Lounge
Roof Space Accessibility	Yes, in hall cupboard
Roof Insulated	Yes



027 7627826



buildmanage.wbi@gmail.com



www.whangareibuildinginspections.com



PO Box 4066, Kamo 0141



2. Utility's

Water source	Mains
Sewage disposal	Mains
Hot water source	Hot water cylinder
Electrical services	Power company





027 7627826 ☎
 buildmanage.wbi@gmail.com ✉
 www.whangareibuildinginspections.com 🌐
 PO Box 4066, Kamo 0141 🏠

3. Smoke Alarms present

1x present in Hallway

1x present in Lounge

No testing was done on the alarms to check if they are working

4. Property description

The scope of this inspection is carried out in accordance with NZS 4306:2005
The dwelling LIM report and/or property information file was not reviewed, and we recommend this is checked to ensure what is recorded on the property file matches what is constructed on site.

Dwelling was built in 1995(est.) The overall condition of the dwelling is good for its age and in line with any other dwelling this aged that has been and has been maintained.

Single level dwelling with sub floor, 3 bedrooms, 2 bathrooms, 2 toilets, 1 bath. Open plan kitchen, dining, and lounge. Situated on a sloping section northeast facing. Dwelling is 1.4km to the nearest convenience store. No mould visible, and all moisture meter readings were in a good range.

Cladding consists of brick (low maintenance), fibrolite weather board with single glazed aluminium windows built on a timber framed foundation. The HIP and valley roof consists of colour tiles and appears in general to be in good condition. Down pipes are PVC with internal guttering to the fascia. External cladding is in good condition for its age. Semi fenced section with a single garage with extra utility sheds. The overall condition of the dwelling is in good condition and has been maintained.

Maintaining your home helps increase its value and lifespan, ensuring the structure continues to perform. Planned preventative maintenance is a proven method of identifying and preventing minor maintenance issues before they escalate into major problems that could cost you more in the long run.

Noted in inspection

- Plywood to Garage floor
- Separate toilet has no vent
- Hallway has surface crack in ceiling
- HRV Located in hallway outside Bedroom 1
- Smoke alarm present in Hallway
- Sensor is present in hallway but cannot find the keypad
- Bedroom 2 has surface crack under window
- Bedroom 2 requires security stays to both windows due to its height off ground.



027 7627826



buildmanage.wbi@gmail.com



www.whangareibuildinginspections.com



PO Box 4066, Kamo 0141



- Master bedroom must have a security stay to both windows due to its height also.
- Ensuite must have a security stay to windows due to its height off ground.
- 2x sheds under house were dry. Both are part board flooring and lined with fibrolite cladding.
- Plywood fence at rare needs repair and maintenance.
- Under house where sheds are the joists are exposed to the outside elements, recommend cladding of fibrolite to these areas for extra protection against any prevailing weather conditions.
- Substructure appears to be in sound condition.
- Shared driveway
- Corner joint (PVC capping) needs to be re-fitted.
- Small patch job has been done in corner of the soffit north end.
- All guttering needs to be cleared as they are too full, and this can create a problem in heavy rain.
- Pergola roof (plastic) is damaged to an area and where this could restrict the flow of water
- Roof tiles are in general good condition however there are a few with damaged due to being stood on it appears.
- Roof structure appears to be in good condition and in keeping with its age.



027 7627826



buildmanage.wbi@gmail.com









www.whangareibuildinginspections.com



PO Box 4066, Kamo 0141



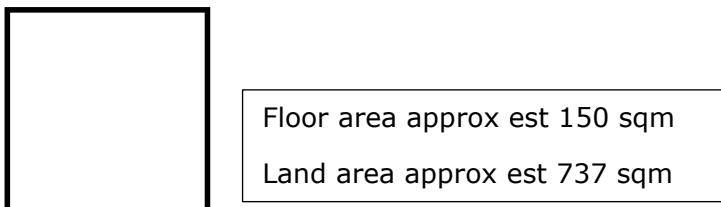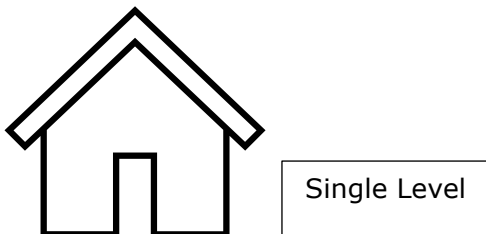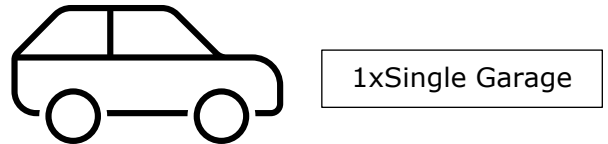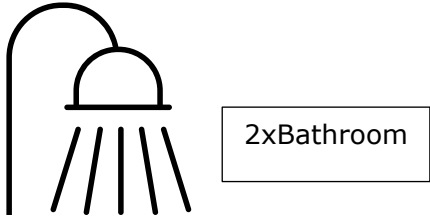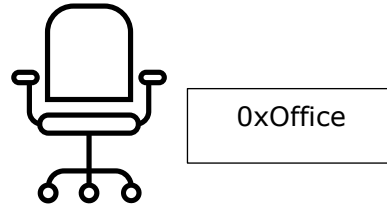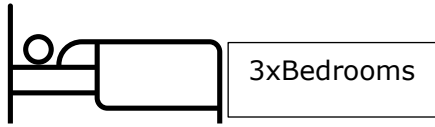

027 7627826



buildmanage.wbi@gmail.com



www.whangareibuildinginspections.com



PO Box 4066, Kamo 0141



5. The Property Inspection Report

a. Purpose of the property inspection

As per New Zealand Standard 4306:2005, section 2.1.2: the purpose of the property inspection is to identify significant defects visible at the time of the inspection.

b. The property report

Section 3.2 of NZS 4306:2005 states that the Property Report shall include the following:

- Any area or item which was not inspected and the reasons which prevented an inspection, and if appropriate, a recommendation for further investigation.
- A summary which includes an opinion as to the overall condition of the dwelling in the context of its age, type and general expectations of similar properties.
- A list of any significant faults or defects.
- Advice of any further inspections deemed necessary, such as those carried out by an electrical inspector, plumbing and drainage inspector, engineer, or surveyor; and
- A certificate confirming that the property inspection has been completed in accordance with this Standard.

6. Equipment used for report

Ladder
Torch
Moisture Meter –Trotec T660
Camera
Voice Recorder



027 7627826



buildmanage.wbi@gmail.com



www.whangareibuildinginspections.com



PO Box 4066, Kamo 0141



7. Moisture Reading Report

The following indicators are used for moisture orientation

Display (digits) = Building Material Moisture Range

Less than 39 digits	=	Dry Material
40 – 80 digits	=	Damp Material
Over 80	=	Wet Material (at risk)

Common digit values for New Zealand conditions

Typical reading for gib covered, raidata pine framed internal walls 30-40 digits

Typical common values for skirted, gib covered radiata pine bottom plates 35-45 digits (dependent on floor construction i.e., concrete floor)

Typical common values for carpet, underlay covered concrete floors 50-60 digits

Typical common values for bare or exposed concrete over 100 digits

Actual moisture readings	
Front Entry	No access to the left-hand side for reading 13.8
Garage	12.6 -22.0
Laundry	5.9 - 8.2
Toilet-separate	5.6 - 8.6
Main Bathroom	7.3 - 9.8
-Bath	4.4 - 13.5
-Shower	6.8 - 16.1
Bedroom1 – light blue	4.7 - 7
Bedroom 2	
-Window 1	4.5 - 10.6
-Window 2	8.3 - 13.4
Bedroom 3 – Master	
-narrow window	9.0 - 9.0
-corner window	4.7 - 5.2 - 13.6
-large window	9.1 - 15.2
Ensuite	13.7 - 18.0
Lounge	
-Large window	7.7 - 7.8
-Ranchslider	15.4 - 24.7
Dining	
-corner window	13.3 - 14.3 - 19.0
-Ranchslider	18.1 - 23.2
Kitchen	6.18 - 9.8
Garage	4.4 - 22.0



027 7627826



buildmanage.wbi@gmail.com



www.whangareibuildinginspections.com



PO Box 4066, Kamo 0141



8. Referenced Documents

2.1 New Zealand Standards

NZS 4306: 2005	Property Inspection
NZS 3019: 2004	Electrical installation – In service testing
NZS 3604: 1999	Timber framed buildings
NZS 4218: 1996	Energy efficiency – Housing and small building envelope
NZS 5261: 2003	Gas installation

2.2 New Zealand Legislation

Building Act 2004
Unit Titles Act 1972

9. Exclusions

This Report does not cover the following:

1. Legal title
2. Building warrant of fitness and services described on a compliance schedule:
3. Planning, resource consent issues
4. Building consent issues
5. Long term maintenance planning
6. Rental property tenancy inspections
7. Heritage obligations; and
8. Compliance with body corporate rules, the terms of a memorandum of cross lease or
9. A company title occupation agreement.
10. Electrical Report
11. Property Records from Whangarei District Council
12. Methamphetamine Screen Test Report
13. Asbestos Test Report

10. Limitations

Within a building inspection there are always various limitations found when carrying it out. Every team member of Whangarei Building Inspections does their best to gain access, view areas and report on any visible areas of concern or note.

Limitations present at this dwelling

- Front entry no access for the moisture meter reading



027 7627826



buildmanage.wbi@gmail.com



www.whangareibuildinginspections.com



PO Box 4066, Kamo 0141



11. Definitions

For the purposes of the Standard, the following definitions shall apply:

Accessory Unit(s). Any area, usually with a specified purpose, which does not comprise part of the dwelling unit footprint but is intended to be used in conjunction with the unit.

Ancillary Spaces and Buildings. Any area, usually with a specified purpose, which does not comprise part of the dwelling unit footprint.

Common Property. An area that is owned collectively by all the unit owners and defined as such in the relevant documents. Areas of common property can include gardens, driveways, access ways, roofs, the exterior fabric of the building, service areas, ducts, the unit occupied by the resident manager; shared building services such as lifts, boiler and water reticulation systems, fire protection and ventilation systems and recreation areas such as gym, tennis court, swimming pool or roof garden.

Minor Fault or Defect. A matter which, in view of the age, type or condition of the residential building, does not require substantial repairs or urgent attention and rectification and which could be attended to during normal maintenance. Minor defects are common to most properties and may include minor blemishes, corrosion, cracking, weathering, general deterioration, unevenness, and physical damage to materials and finishes.

Multi-Unit Property (ies). Any property that accommodates more than one residential dwelling unit and where the owners have collective obligations. Multi-unit properties will usually be owned under a body corporate, cross lease or company title where the relevant legislation along with the body corporate rules and unit plan, memorandum of lease and flat plan or constitution and occupation agreement define the areas of individual and collective responsibility.

Property Inspection. A non-invasive visual inspection of a residential building carried out in accordance with 2.1 New Zealand Standard.

Reasonable Access. Areas where safe, unobstructed access is provided and the minimum clearances specified below; or where these clearances are not available, area within the inspector's unobstructed line of sight.

Area	Access manhole (mm)	Crawl space (mm)	Height
Roof Space	450 x 400	600 x 600	Accessible from a 3.6m ladder*
Subfloor	500 x 400	Vertical clearance Timber floor: 400** Concrete floor: 500	
Roof exterior			Accessible from a 3.6m ladder*

- *Or such other means of access that meet OSH requirements
- ** From underside of bearer.



027 7627826



buildmanage.wbi@gmail.com



www.whangareibuildinginspections.com



PO Box 4066, Kamo 0141



Significant Fault or Defect. A matter which requires substantial repairs or urgent attention and rectification.


Survey. A separate, detailed inspection and report that may require invasive and/or specialised testing equipment and may require the specialist knowledge of a relevantly qualified expert.

12. Interpretation


- The word “shall” identify a mandatory requirement for compliance with the Standard.
- The word “should” refer to practices which are advised or recommended.
- When cross-referencing to other clauses or clause subdivisions within this standard, the number is only quoted.
- The full titles of referenced documents cited in this Standard are given in the list of “Referenced Documents” immediately preceding the Foreword.


The terms “Normative” and “Informative” have been used in this Standard to define the application of the Appendix to which they apply. A “Normative” Appendix is an integral part of the Standard whereas an “Informative” Appendix is only for information and guidance. Informative provisions do not form part of the mandatory requirements of the Standard.



027 7627826 

buildmanage.wbi@gmail.com 

www.whangareibuildinginspections.com 

PO Box 4066, Kamo 0141 

13. Abbreviations as per standard

The following abbreviations may be used in this Standard.

o	Degrees
CCTV	Closed Circuit Television
EIFS	External Insulation Finishing System
m	Metre
mm	Millimetre
OSH	Occupational Safety and Health
PCBs	Polychlorinated Biphenyls
RCD	Residual Current Device
uPVC	Unplasticized Polyvinyl Chloride
WC	Water Closet



027 7627826



buildmanage.wbi@gmail.com



www.whangareibuildinginspections.com



PO Box 4066, Kamo 0141



14. Property Inspection Photos

Interior Photos

Front Entry



No access to check reading on left side



027 7627826


buildmanage.wbi@gmail.com

www.whangareibuildinginspections.com


PO Box 4066, Kamo 0141



Garage

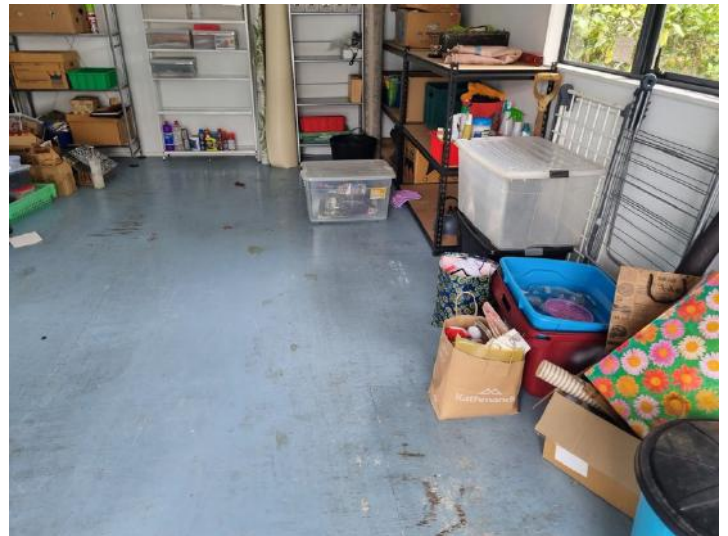



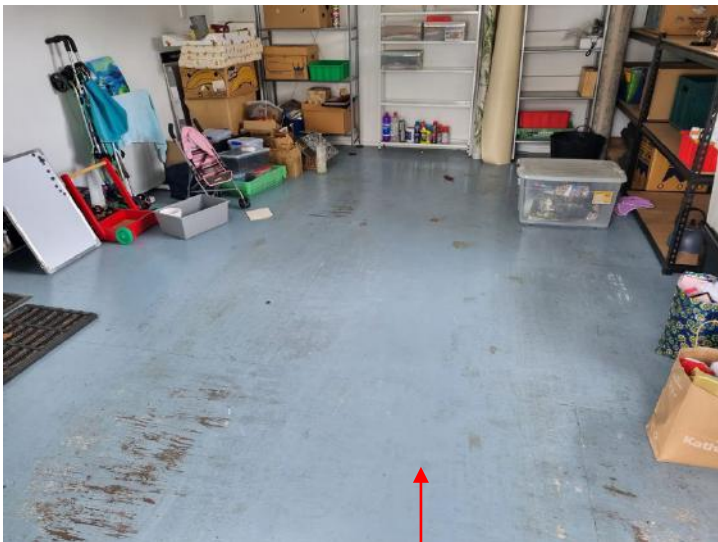

Power board located in garage



Plywood to garage floor











027 7627826 
buildmanage.wbi@gmail.com 
www.whangareibuildinginspections.com 
PO Box 4066, Kamo 0141 

Laundry





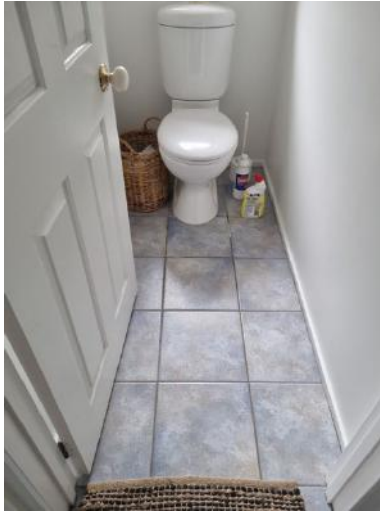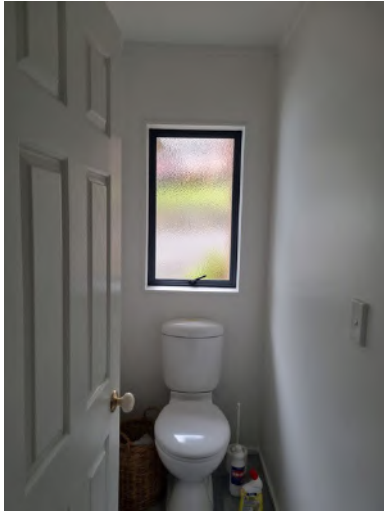

027 7627826 
buildmanage.wbi@gmail.com 
www.whangareibuildinginspections.com 
PO Box 4066, Kamo 0141 

Toilet- separate







Separate toilet has no vent




027 7627826 
buildmanage.wbi@gmail.com 
www.whangareibuildinginspections.com 
PO Box 4066, Kamo 0141 





Main Bathroom

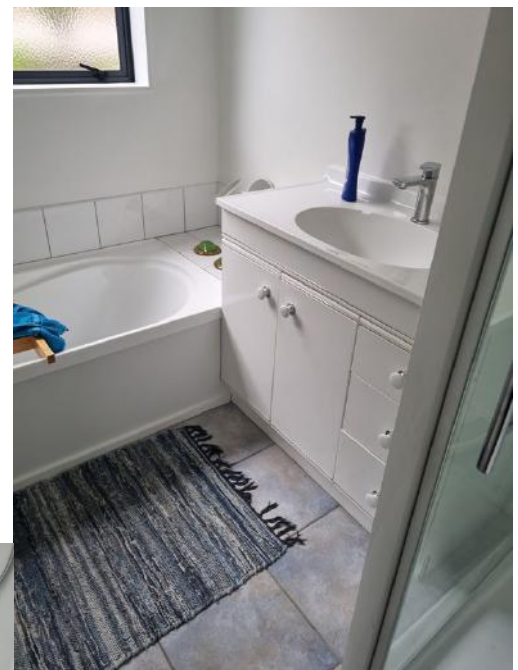

027 7627826 
buildmanage.wbi@gmail.com 
www.whangareibuildinginspections.com 
PO Box 4066, Kamo 0141 

Bath







027 7627826 
buildmanage.wbi@gmail.com 
www.whangareibuildinginspections.com 
PO Box 4066, Kamo 0141 

Shower




Bathroom extraction



027 7627826 
buildmanage.wbi@gmail.com 
www.whangareibuildinginspections.com 
PO Box 4066, Kamo 0141 

Hallway

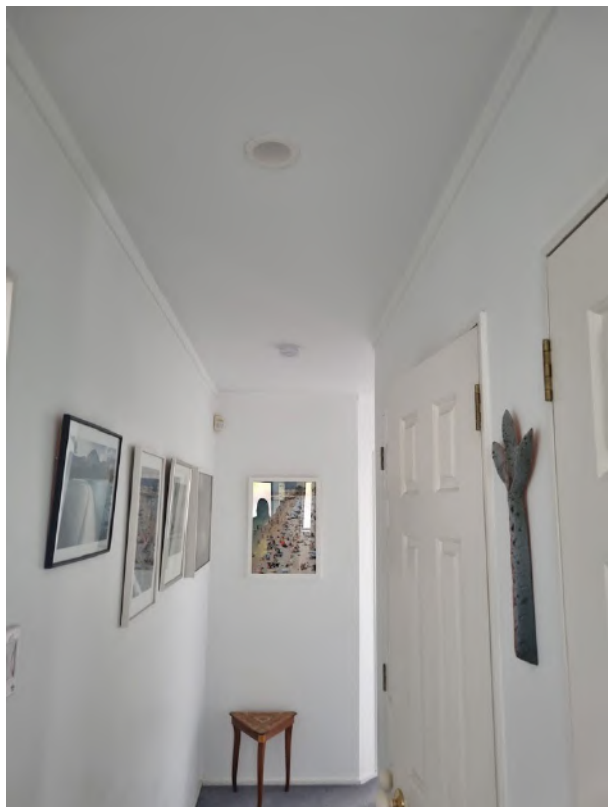

027 7627826



buildmanage.wbi@gmail.com




www.whangareibuildinginspections.com



PO Box 4066, Kamo 0141



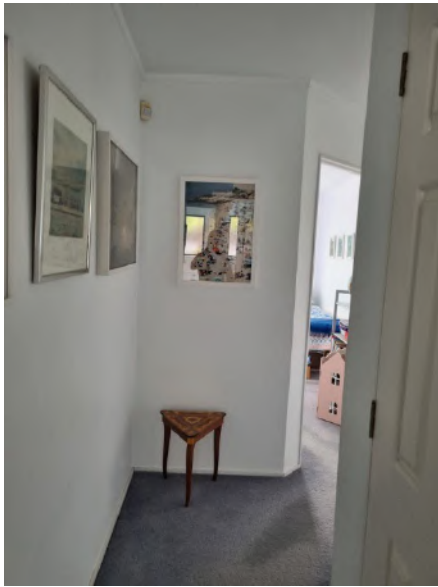

Hallway has surface crack in ceiling



HRV Located in hallway outside Bedroom 1



Sensor is present in hallway but cannot find keypad

Smoke alarm present in Hallway



027 7627826 ☎
buildmanage.wbi@gmail.com ✉
www.whangareibuildinginspections.com 🌐
PO Box 4066, Kamo 0141 🏠

Bedroom1



HRV outlet



027 7627826 ☎
buildmanage.wbi@gmail.com ✉
www.whangareibuildinginspections.com 🌐
PO Box 4066, Kamo 0141 🏠

Bedroom2



HRV outlet



Bedroom2 has surface crack under window




027 7627826

buildmanage.wbi@gmail.com

www.whangareibuildinginspections.com

PO Box 4066, Kamo 0141



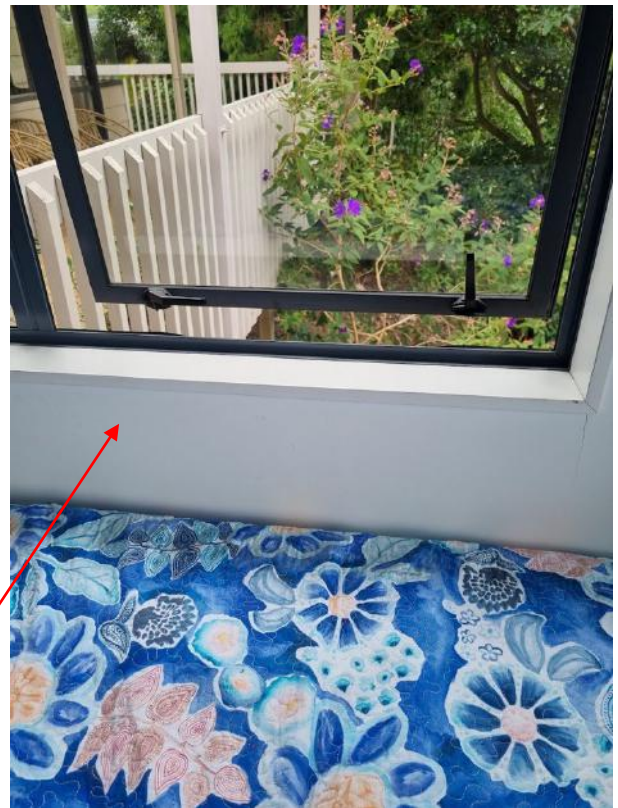

Bedroom 2 must have security stays to both windows due to its height of ground.



027 7627826



buildmanage.wbi@gmail.com



www.whangareibuildinginspections.com




PO Box 4066, Kamo 0141



Bedroom3- Master

Master bedroom must have a security stay to both windows due to its height off ground.

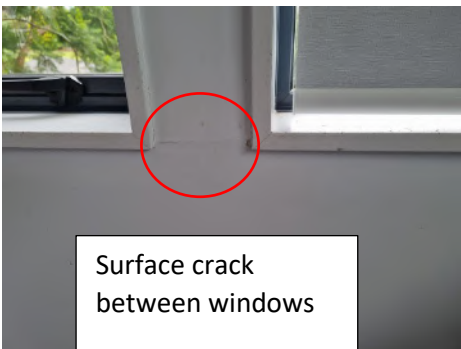

Surface crack between windows




027 7627826
buildmanage.wbi@gmail.com
www.whangareibuildinginspections.com
PO Box 4066, Kamo 0141





HRV outlet

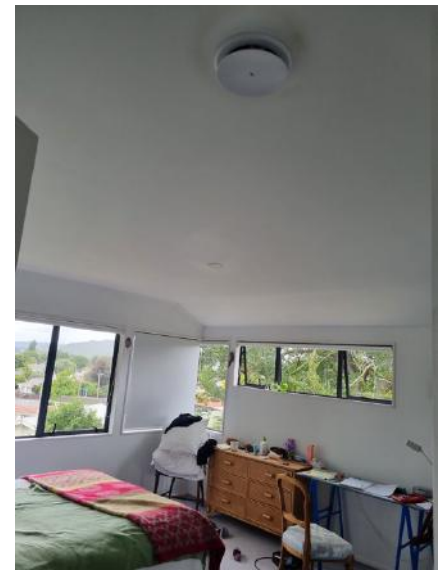

027 7627826



buildmanage.wbi@gmail.com



www.whangareibuildinginspections.com



PO Box 4066, Kamo 0141




Ensuite

Bathroom extraction



Ensuite must have a security stay to both windows due to its height off ground.

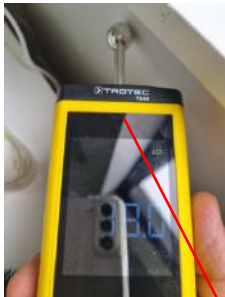

027 7627826

buildmanage.wbi@gmail.com

www.whangareibuildinginspections.com

PO Box 4066, Kamo 0141



PeLounge



027 7627826



buildmanage.wbi@gmail.com





www.whangareibuildinginspections.com



PO Box 4066, Kamo 0141



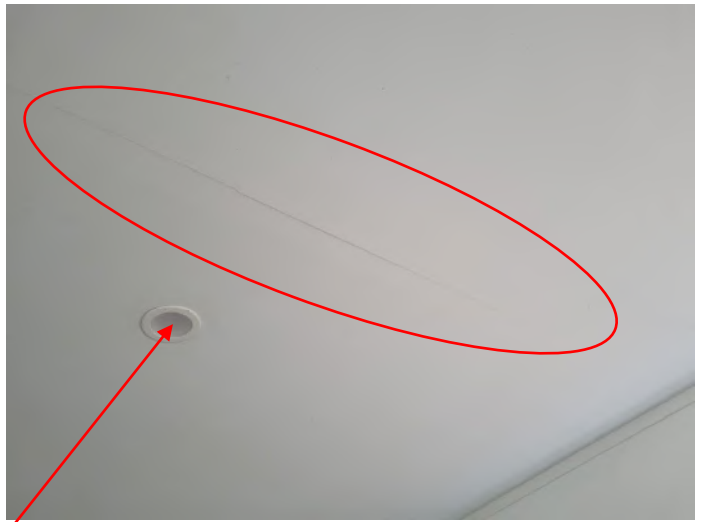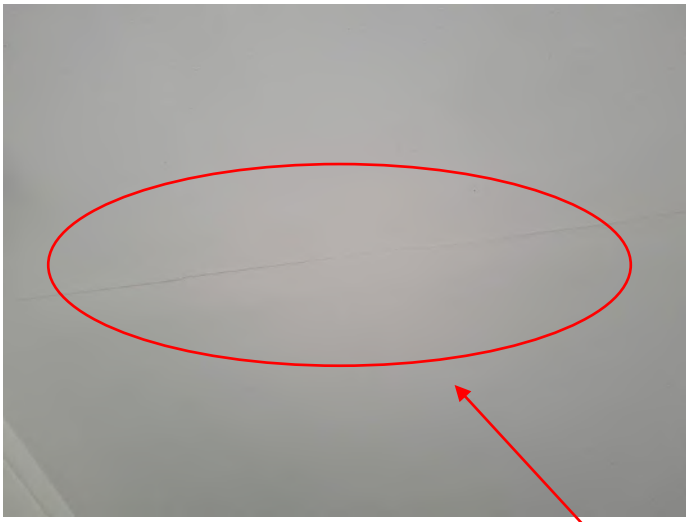

Surface crack across ceiling



HRV outlet




027 7627826
buildmanage.wbi@gmail.com
www.whangareibuildinginspections.com
PO Box 4066, Kamo 0141

Dining



HRV outlet

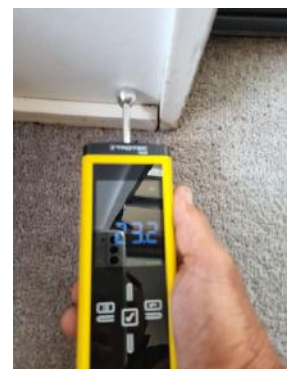

027 7627826


buildmanage.wbi@gmail.com

www.whangareibuildinginspections.com

PO Box 4066, Kamo 0141



Kitchen

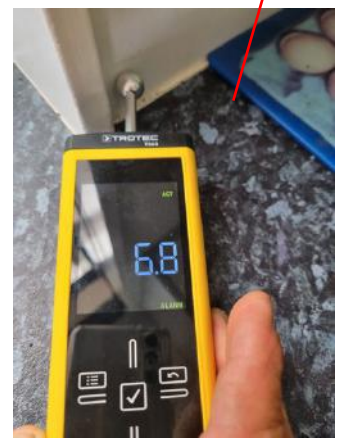

027 7627826 ☎
buildmanage.wbi@gmail.com ✉
www.whangareibuildinginspections.com 🌐
PO Box 4066, Kamo 0141 🏠



027 7627826



buildmanage.wbi@gmail.com



www.whangareibuildinginspections.com



PO Box 4066, Kamo 0141



Under Roof – access in hall cupboard



027 7627826



buildmanage.wbi@gmail.com



www.whangareibuildinginspections.com



PO Box 4066, Kamo 0141





027 7627826



buildmanage.wbi@gmail.com



www.whangareibuildinginspections.com







PO Box 4066, Kamo 0141



Exterior Photos

Dwelling front outside and driveway



027 7627826 
buildmanage.wbi@gmail.com 
www.whangareibuildinginspections.com 
PO Box 4066, Kamo 0141 



027 7627826



buildmanage.wbi@gmail.com




www.whangareibuildinginspections.com



PO Box 4066, Kamo 0141



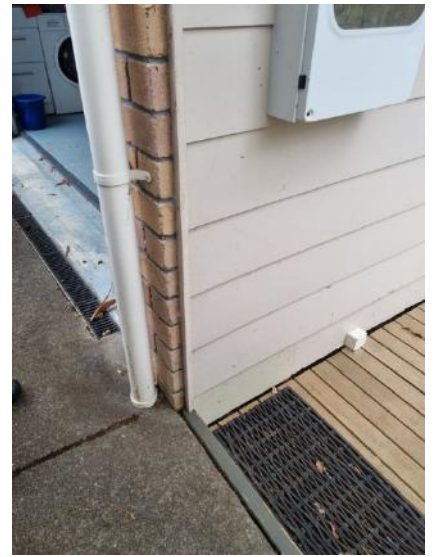

027 7627826



buildmanage.wbi@gmail.com



www.whangareibuildinginspections.com



PO Box 4066, Kamo 0141





2x sheds under house were dry. Both are part board flooring and lined with fibrolite cladding.



027 7627826 ☎
 buildmanage.wbi@gmail.com ✉
 www.whangareibuildinginspections.com 🌐
 PO Box 4066, Kamo 0141 🏠



027 7627826



buildmanage.wbi@gmail.com



www.whangareibuildinginspections.com



PO Box 4066, Kamo 0141





Plywood fence at rare needs maintenance



027 7627826



buildmanage.wbi@gmail.com




www.whangareibuildinginspections.com



PO Box 4066, Kamo 0141



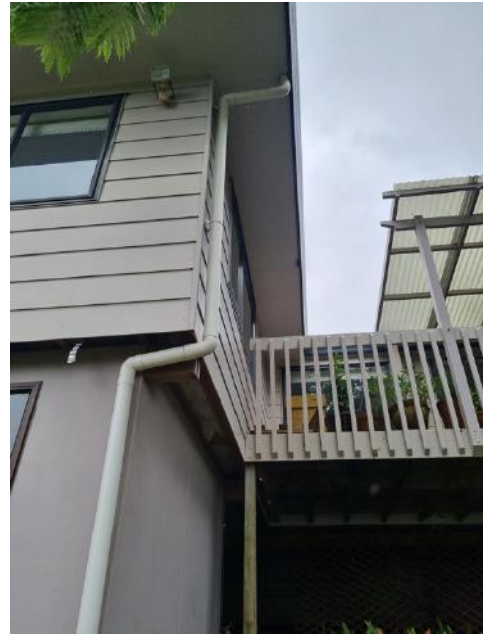

027 7627826



buildmanage.wbi@gmail.com



www.whangareibuildinginspections.com







PO Box 4066, Kamo 0141





Under house where sheds are the joists are exposed to the outside elements. Recommend cladding of fibrolite to these areas for protection against the outside conditions. Treatment H1.2 not H 3.2



027 7627826 
 buildmanage.wbi@gmail.com 
 www.whangareibuildinginspections.com 
 PO Box 4066, Kamo 0141 



Substructure appears in sound condition



027 7627826



buildmanage.wbi@gmail.com



www.whangareibuildinginspections.com



PO Box 4066, Kamo 0141





027 7627826



buildmanage.wbi@gmail.com



www.whangareibuildinginspections.com



PO Box 4066, Kamo 0141



Shared driveway



Corner joint (PVC capping) needs to be refitted.



027 7627826



buildmanage.wbi@gmail.com



www.whangareibuildinginspections.com



PO Box 4066, Kamo 0141





Small patch job has been done in corner of roof.



027 7627826



buildmanage.wbi@gmail.com



www.whangareibuildinginspections.com



PO Box 4066, Kamo 0141





All guttering needs to be cleaned to avoid water backing up and going inside.



027 7627826



buildmanage.wbi@gmail.com



www.whangareibuildinginspections.com



PO Box 4066, Kamo 0141





Pergola roof (plastic) is bent in one area and water will sit in it so recommend replacing 1-2 sheets.



Roof tile has a bend, like someone has stood on it



027 7627826



buildmanage.wbi@gmail.com



www.whangareibuildinginspections.com



PO Box 4066, Kamo 0141



15. Certificate of inspection

Certificate of Property Inspection

In accordance with NZ Standard 4306:2055

Client: Paul Sumich - C/o Bayleys
Site Address: 1 Kentia Lane, Whau Valley
Whangarei

Property Inspector: Mike Wooding
Company: Build Manage Limited
Qualification: Trade certified builder
Licenced Building Practitioner
New Zealand Certified Builders

The following areas have been inspected

- a) Site
- b) Subfloor
- c) Exterior
- d) Roof Exterior
- e) Roof space
- f) Interior
- g) Services
- h) Accessory units, ancillary spaces and buildings

I hereby certify that I have carried out the inspection of the property site at the above address in accordance with NZS 4306:2005 Residential Property Inspections, and I am competent to undertake this inspection.

Signed

M J Wooding

Print Name: Mike Wooding

Date: 01/02/2022



027 7627826



buildmanage.wbi@gmail.com



www.whangareibuildinginspections.com



PO Box 4066, Kamo 0141



16. Terms & Conditions

1. In these conditions unless the context otherwise requires:
"Terms" means the terms as specified in this document
"Company" means Build Management Limited
"Customer" means the person, firm, Company, trust or other entity having instructed the Company
"Parties" means the Company and the Customer collectively
"Property" means the building or structure which the Customer has instructed the Company to inspect.
"Inspection Report" means the report produced from the inspection of the Property
"Inspector" means the employee, contractor, or agent appointed by the Company to carry out the inspection of the Property.
"Standard" means the Residential Property Inspection Standard NZS 4306:2005.

Where the context requires or admits, words importing the singular shall import the plural and vice versa.

2. The inspection is a visual one only of the above ground building elements which could be seen easily and shall be done in accordance with the Standard. This report does not include:
 - a. any item that is closed in or concealed including flooring, walls, ceiling, framing, plumbing, drainage, heating, ventilation, and wiring etc. Therefore, the Company or Inspector is unable to report that any such part of the structure is free from defect. (If visual inspection is prevented or inhibited by any obstacle including but not limited to cladding or lining materials, surface coverings, fixtures and fittings, furniture, soil and plants, the Company's inspection shall base the report upon a visual inspection without removing these obstacles)
 - b. any electrical, plumbing or gas piping and fitting, healthy home standard compliance, as our Inspectors are not qualified for this.
 - c. assessment of:
 - i. Legal title
 - ii. Boundaries or survey
 - iii. Building warrant of fitness
 - iv. Building consent
 - v. Resource consent
 - vi. Maintenance planning
 - vii. Rental property tenancy inspections
 - viii. Heritage obligations
 - ix. Compliance with body corporate rules (if any)
 - x. Methamphetamine contamination
 - xi. Asbestos
 - xii. Utility services (electricity, water, gas, telco, fibre)
 - xiii. Consistency with existing plans held by the local council
 - d. any common or shared areas in a building complex.
3. The Customer acknowledges the inspection will not be carried out in whole or in part if undue health and safety risk is posed to the Inspector.
4. The Customer acknowledges unless it is specifically requested to be investigated, the Company and its Inspector shall assume all materials and systems are of standard typical construction.
5. The Customer acknowledges that the Company or its Inspectors will not be responsible for failing or omitting to include advice in the report in respect of; Structural or geotechnical defects in the Property or fixtures and fittings attached thereto; Latent defects in the Property or fixtures attached thereto, whether of a structural or geotechnical nature or otherwise; Defects in areas of the building which are inaccessible to a visual inspection or which are not reasonably discoverable upon a visual inspection, and defects which may arise after the date of inspection from any cause whatsoever including but without limitation, abnormal weather conditions or abnormal uses or abuses of the building or the fixtures and fittings attached thereto.
6. The Customer acknowledges that the Company and its Inspector will not be responsible for failing or omitting to include advice in the report on whether the Property complies with local by-laws, town planning requirements, legislation, or regulation.
7. The Customer certifies that the owner of the Property or authorised agent for the owner has consented to the Company's Inspector gaining access to the Property for the purpose of an inspection.



027 7627826



buildmanage.wbi@gmail.com



www.whangareibuildinginspections.com



PO Box 4066, Kamo 0141



8. The Inspection Report and its findings are valid for 3 months from the date of the inspection, after which time the Company and or the Inspector will not be held liable or accountable for the report, its findings and or future issues regarding the inspected Property.
9. The Customer acknowledges that due to certain weather conditions and temperatures thermal imaging and other moisture testing equipment may not give accurate findings.
10. This report is for the sole use of the Customer only and may not be used by others without the permission of the Company. The Customer shall indemnify the Company and/or the Inspector and hold them harmless for any and all claim whatsoever by any third party that relied or acted on the contents of the Inspection Report.
11. Upon the issue of any invoice, the Customer shall make full payment within 14 days of the invoice date. Payments made after this time will incur a 15% per annum interest on top of the invoice until paid in full. The customer indemnifies the Company in respect of all costs incurred by the Company including court costs, legal expenses on a solicitor and client basis, and any debt collection costs and commission, and any other costs and expenses incurred in taking steps or attempting to take steps towards enforcing the Company's rights under these Terms.
12. It is expressly agreed the Company may retain all or any part of the inspection report until satisfactory payment in full has been received by the Company in respect of such inspection and all other moneys owing by the Customer to the Company.
13. Except to the extent that cannot be contracted out by law, the total liability of the Company and/or the Inspector shall not exceed the sum of the invoices issued in relation to the inspection of the Property. For the purpose of any claim against the Company and/or the Inspector, as defined by the Limitation Act 2010 (the Act), whether in contract, tort, equity or otherwise, arising out of the inspection of the Property, the Act shall be modified so that any claim must be filed within 12 months after the date of the act or omission on which the claim is based. Further, the "late knowledge" provisions in sections 11(2), 11(3), 14 and 32(2) shall not apply. The 12-month time period applies whether or not loss or damage has become apparent, or has been suffered, within that time period.
14. If the Inspection requested by the Customer is to be carried out for the purposes of a business, then all guarantees, warranties, rights or remedies implied by the Consumer Guarantees Act 1993, the Fair-Trading Act 1986 or any similar statutes are expressly excluded. To the maximum extent permitted by law, all guarantees, warranties or provisions that would otherwise be implied by statute or rule of law are expressly excluded, as are any representations or statements made prior to these terms and conditions taking effect.



027 7627826



buildmanage.wbi@gmail.com



www.whangareibuildinginspections.com



PO Box 4066, Kamo 0141

